

Mounting instruction

ECOFLEX® 10 HEATEX

N-Socket / Art. Nr.: 7361



1



Cut off cable tail right-angled.

2



Move the nut, clamping ring and rubber washer over the cable tail. Hint: With a bit of Vaseline the rubber washer can be moved easily over the cable sheath.

3



Remove 6 mm of the outer sheath with a knife.

4



Bend copper braid upwards right-angled. Insert contact sleeve between copper foil and braid until stop. Cut off protruding braid. Move the rubber seal to the front, up to the contact sleeve.

5



Remove the copper foil and the dielectric with a knife.

6



Attach inner pin to the inner conductor and solder carefully. Then put on the Teflon-Isolator.

7



The prepared cable tail has to be inserted into the housing until stop. Tighten the clamping nut finger tight with two open-ended spanners 17/18 mm. A small split should remain visible between clamping nut and connector housing.