

Mounting instruction

AIRCELL®5

N-Connector, crimp / item. No.: 7701




1
Cut off cable tail right-angled. Move the crimp-cover over the cable head. Cut off 16 mm of the outer sheathing with a knife.



2
Bend copper braid upwards right-angled.



3
Slit slightly a length of 8 mm of the copper foil and remove it.

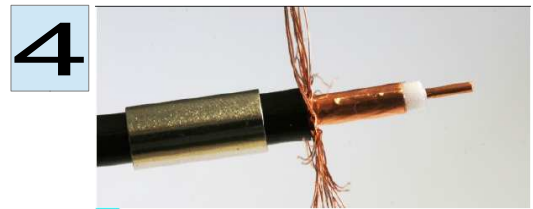

4
Remove 6 mm of the dielectric.



5
Put the head pin onto the inner conductor and solder/crimp it.



6
Insert the prepared cable end into the connector housing as far as it will go (Click).



7
Cut off the copper braid with a side cutter and move the crimp jacket to the front.



8
Crimp the crimp jacket with a crimp tool; herewith the copper braid will be trapped between the crimp jacket and the connector housing.