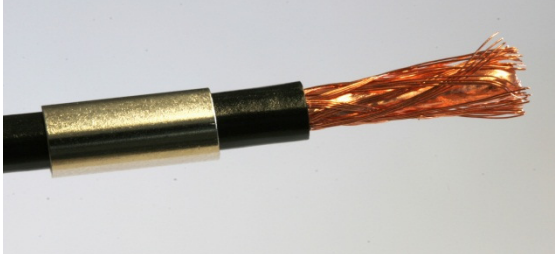


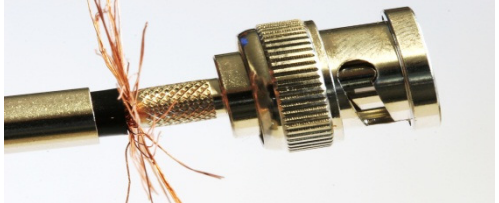
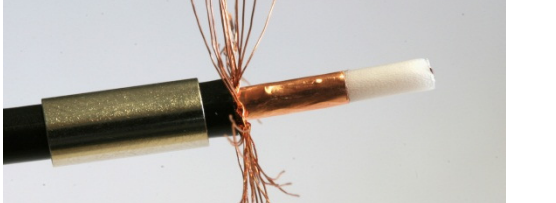

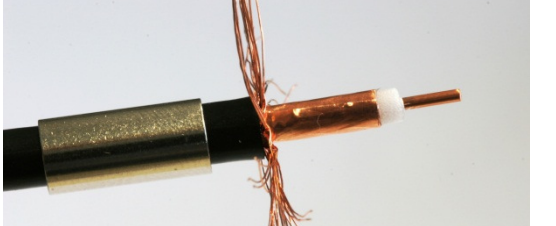



## Mounting instruction

AIRCELL®5

BNC-Connector, crimp/ Art. No. 7721

	
<p><b>1.</b> Cut off cable tail right-angled. Move the crimp-cover over the cable head. Cut off 16 mm of the outer sheathing with a knife.</p>	<p><b>5.</b> Put the head pin onto the inner conductor and solder/crimp it.</p>
	
<p><b>2.</b> Bend copper braid upwards right angled.</p>	<p><b>6.</b> Insert the prepared cable head into the connector housing as far as it will go (click).</p>
	
<p><b>3.</b> Slightly slit and remove 7 mm of the copper foil with a knife.</p>	<p><b>7.</b> Cut off the copper braid with a side cutter and move the crimp jacket to the front.</p>
	
<p><b>4.</b> Remove 5 mm of the dielectric.</p>	<p><b>8.</b> Crimp the crimp jacket with a crimp tool; herewith the copper braid will be trapped between the crimp jacket and the connector housing.</p>